

SERVICE NOTE (T7W E80 315)

SE-0280

This service PCB is exclusively used for models with PUIHZ- shown below:

Note that it cannot be used for other models.

Target models:
PUHZ-RP35VHA4, PUHZ-RP50VHA4, PUHZ-RP60VHA4, PUHZ-RP71VHA4

<List of Accessories> RP●●VHA4 series,

Product name	Qty	Remarks
①Control PCB	1	PCB for replacement
②Part Installation Manual	1	This manual
③Installation support	10	For securing PCB

※Use ③Installation support as replacement part if the support used in the body is broken, etc.

Description

Contents of function selection set using the remote control may have been changed from those set initially at the factory.

Therefore, confirm the current setting of function selection before replacing the PCB.


If contents of function selection using the remote have been changed from initial setting at the factory, re-set to the settings before replacing the PCB after service PCB has been replaced.

1Setting switches on PCB:

All switches on PCB - SW1 (Address), SW4 (Test Operation), SW5 (Function Switch), SW7 (Function Setup), SW8 and SW9 - are set to OFF: Set to the same status as in the replaced PCB (see Fig.1).

2Setting SW6 and SW5-5,6 on PCB:

The setting of SW6 and SW5-5,6 varies depending on the model: Set it according to Table 1.

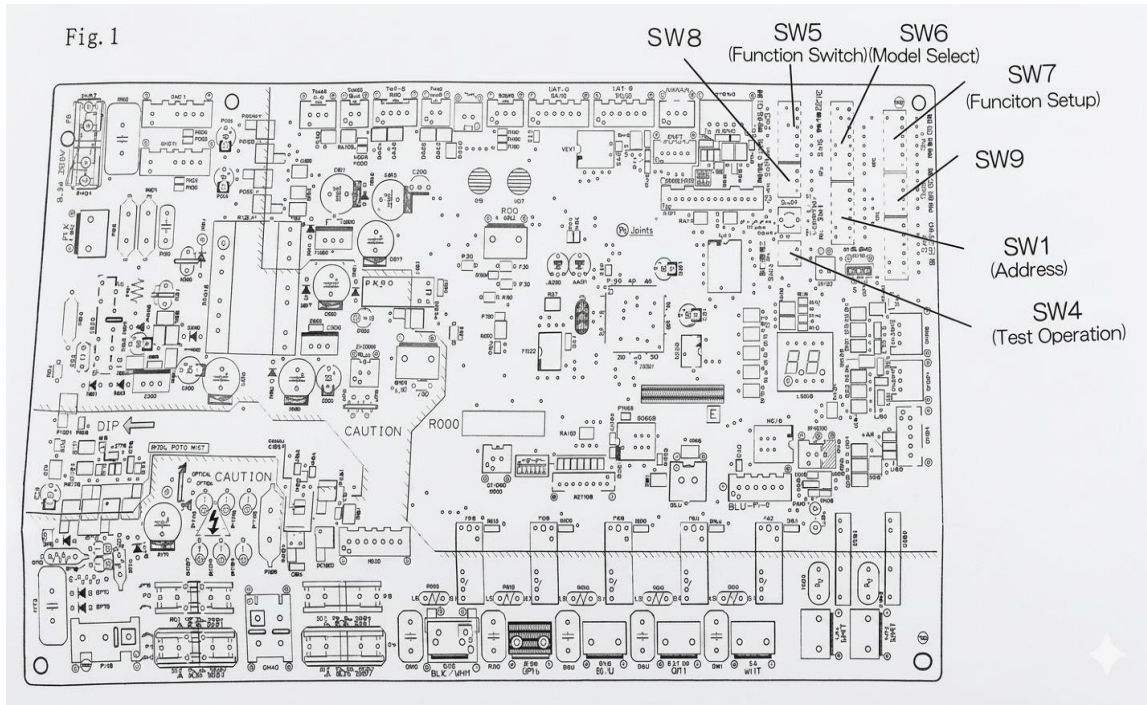

<Table 1> Setting SW6 and SW5-5,6

Model	SW6								SW5							
PUHZ-RP35VHA4	ON					6										6
	OFF	1	2	3	4	5		7	8					5		

PUHZ-RP50VHA4	ON					5	6			ON						6
	OFF	1	2	3	4			7	8		OFF					5
PUHZ-RP60VHA4	ON							7		ON						6
	OFF	1	2	3	4	5	6		8		OFF					5
PUHZ-RP71VHA4	ON					5		7		ON						6
	OFF	1	2	3	4		6		8		OFF					5

RG79V725H27

SW5-1,2,3,4 are made the same setup as the PCB before exchange.

